



Windows W03 - Room 4, Reception Office

Interior Fire-Rated Windows:

Provide a 1-hour fire-rated interior window assembly, tested and labeled in accordance with NFPA 257 or UL 9. Assembly shall include:

- Fire-rated glazing: Clear, safety-rated glass compliant with ASTM C1048, listed for fire-resistance and impact safety where required by code.
- Fire-rated hollow metal frame: UL-listed, welded hollow metal frame with a fire-resistance rating equal to or greater than the glazing.
- Entire assembly shall be installed per the manufacturer's tested and listed system, in compliance with IBC Section 716.

ADDENDUM 4 - WINDOW SPECIFICATIONS ROOM 4 - RECEPTION OFFICE


PROJECT ADDRESS:

Westside Health Care District 100 E. North Street Taft, CA. 93268 PROJECT CONTACT:

Ryan Shultz, MSHCA Executive Director

> (661) 765-7234 Office (661) 203-5757 Cell rshultz@wshcd.org

PAGE 1 of 2 DATE: 7/8/2025

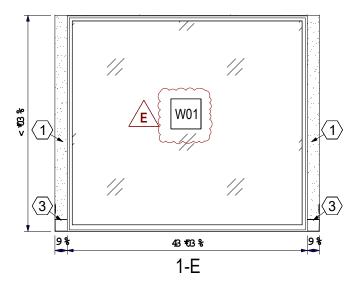




Windows W01 - Room 1, Administration Office

Interior One-Way Storefront Window:

- Provide interior storefront-type glazing system with one-way visibility, allowing visual access from administration office to lobby only.
- System shall include:
- Aluminum storefront framing to match adjacent glazing systems in profile and finish.
- One-way reflective glazing or mirror film applied to interior face, designed to provide privacy while allowing observation from the opposite side.
- Glazing shall be tempered or laminated safety glass per ANSI Z97.1 and CPSC 16 CFR 1201.
- Install per manufacturer's recommendations for film or coated glass orientation and performance.

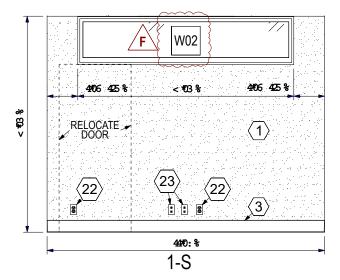



Windows W02 - Room 1, Administration Office

Interior Storefront Window:

Provide interior storefront-type glazing system allowing full visibility between the administration office and lobby. System shall include:

- Aluminum storefront framing to match adjacent glazing systems in profile and finish.
- Clear tempered or laminated safety glass, compliant with ANSI Z97.1 and CPSC 16 CFR 1201.
- Install per manufacturer's recommendations, ensuring proper alignment, sealing, and integration with adjacent construction.

ADDENDUM 4 - WINDOW SPECIFICATIONS ROOM 1 - ADMINISTRATION OFFICE

PROJECT ADDRESS:

Westside Health Care District

100 E. North Street Taft, CA. 93268 PROJECT CONTACT:

Ryan Shultz, MSHCA

Executive Director

(661) 765-7234 Office (661) 203-5757 Cell rshultz@wshcd.org PAGE 2 of 2 DATE: 7/8/2025

REQUEST FOR INFORMATION (RFI)

PROJECT:	Building "A" Remodel and Buildir Renovations	ng	RFI NO.:	PB-004		
	Kenovations					
OWNER:	West Side Health Care District		DATE:	07/07/2025		
CONTRACTOR:	Black/Hall Construction, Inc. P.O. Box 445 Taft, CA 93268					
DRAWING REFE	RENCE:	SI	PECIFICATI	ON REFERENCE:		
BRIEF TITLE: Window						
Frames						
DESCRIPTION OF CLARIFICATION REQUIRED (attach sheets as necessary):						
Please clarify if the window frames are storefront frames or hollow metal frames.						
CONTRACTOR'S	PROPOSED SOLUTION:					
SEE ATTACHED	ADDENDUM 4					
INITATOR: Black	(/ Hall Construction Inc.	SIGNATUR	E:			
DATE RESPONSE	REQUIRED: ASAP					

REQUEST FOR INFORMATION (RFI)

PROJECT:	Building "A" Remodel and Buildir Renovations	ng RFI NO. :	PB-005			
OWNER:	West Side Health Care District	DATE:	07/07/2025			
CONTRACTOR:	Black/Hall Construction, Inc. P.O. Box 445 Taft, CA 93268					
DRAWING REFERENCE:		SPECIFICATION REFERENCE:				
BRIEF TITLE: Glass Type						
DESCRIPTION OF CLARIFICATION REQUIRED (attach sheets as necessary):						
CONTRACTOR'S PROPOSED SOLUTION: Clarification – Exam Room 1 Shielding Note: The reference to "windows" in the shielding note for Exam Room 1 was included as part of a general description. There are no windows in Exam Room 1, and no x-ray glass is included in the scope of this project. Lead lining requirements apply only to the door and walls, as indicated and per the Physicist's Shielding Report and Plan.						
	/ Hall Construction Inc.	SIGNATURE:				
DATE RESPONSE	<u> </u>	SIGNATORE.				